

EXCESSIVE FUEL CONSUMPTION. Carburetor fuel line or gas tank leaking; choke closed; incorrect carburetor setting.


SKI ASSEMBLY. Poor steering ability due to loose skis; worn wear rod. Poor riding characteristics due to loose or defective ski-dampers.

STEERING. Poor steering ability caused by improperly adjusted skis; steering linkage loose or out of adjustment. U-bracket bolts on roll bar too tight or too loose. Spring, U-bracket loose.


THROTTLE CONTROL. Excessive play in throttle control lever caused by loose throttle control cable.

MODEL SD18M29A


**ENGINE
HIRTH 650**

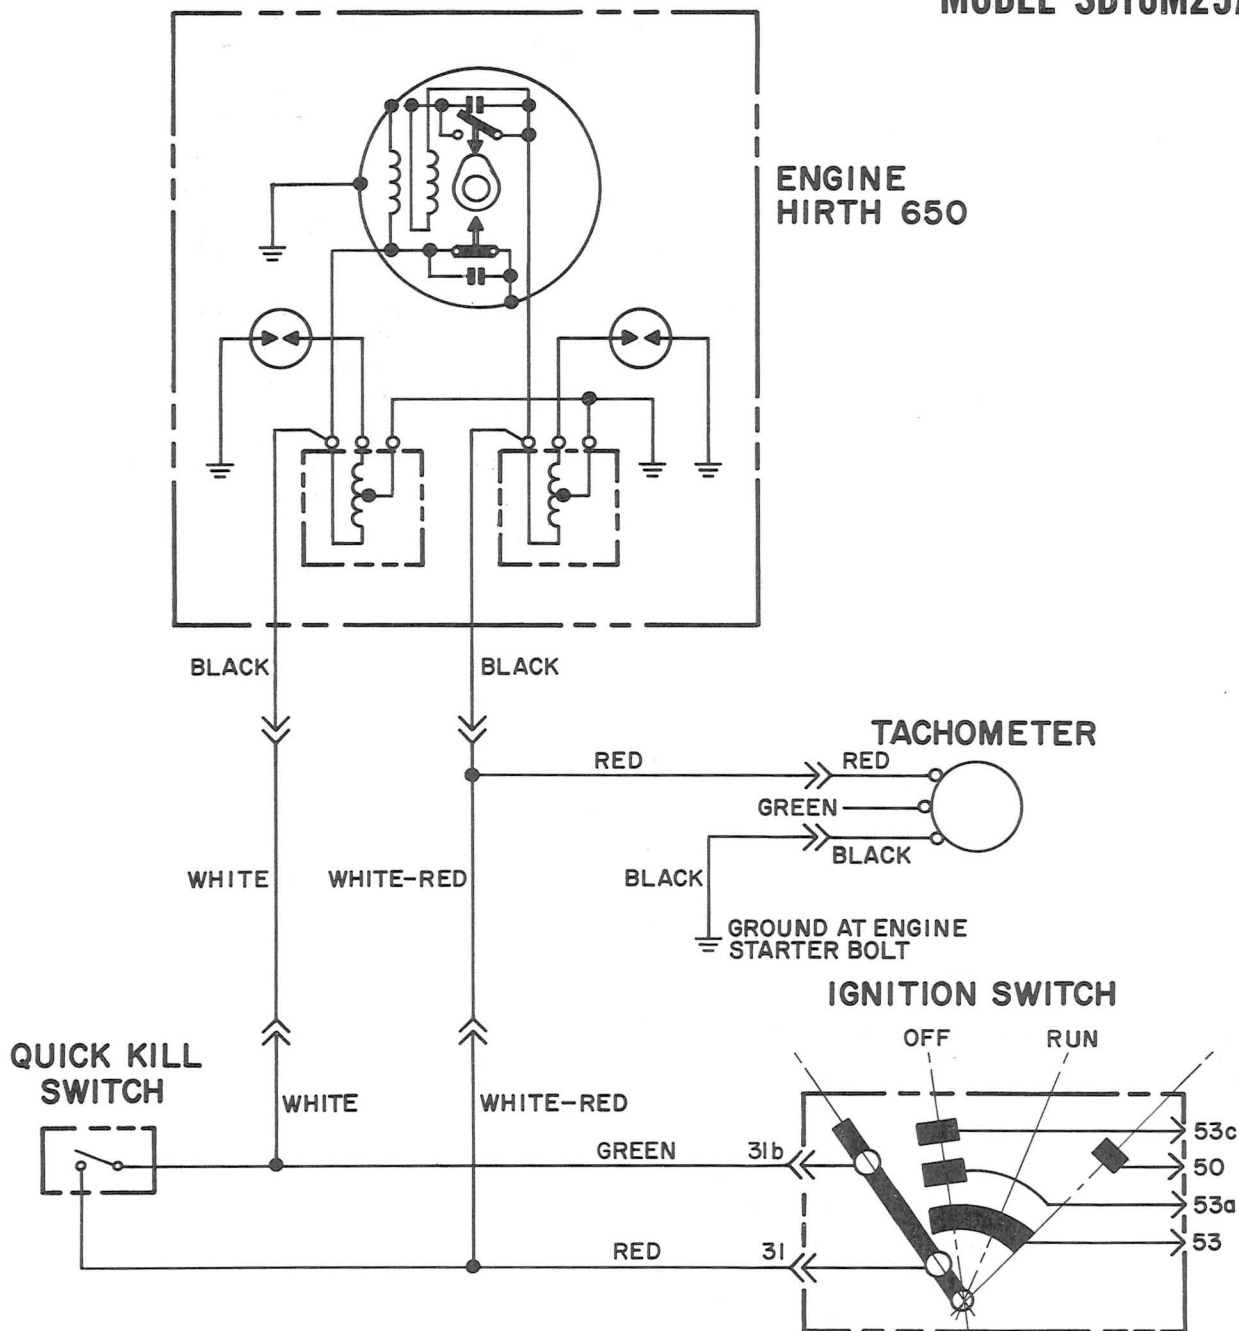

MODEL SD18M30B

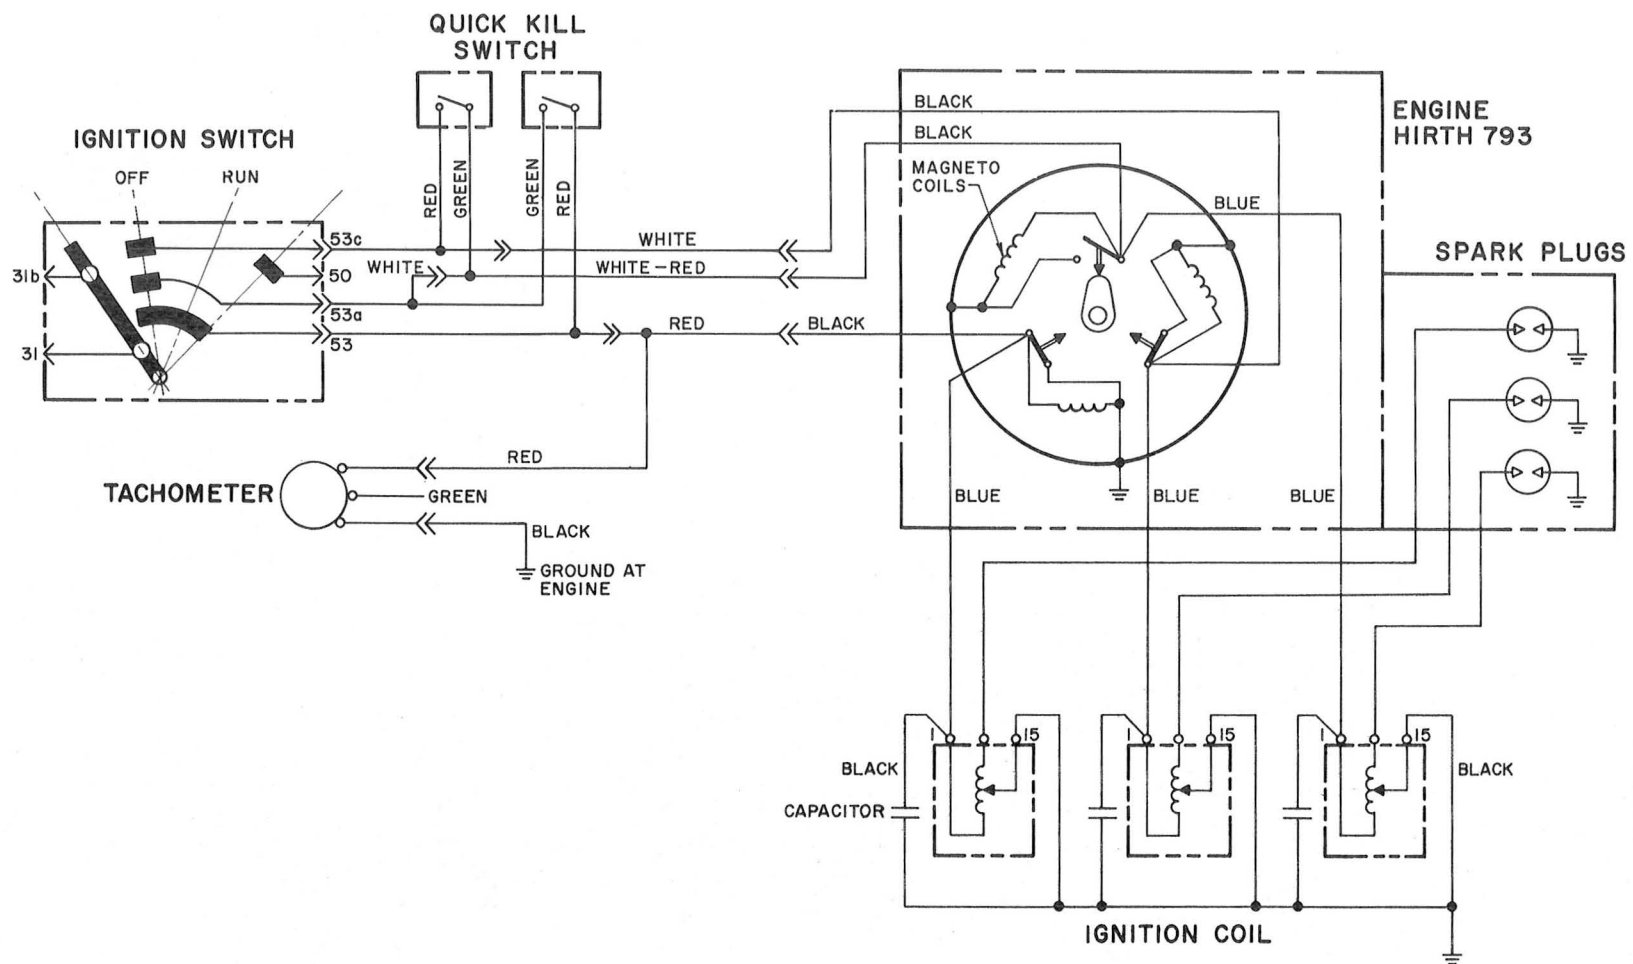

MODELS SD15M28A and SD15M26A

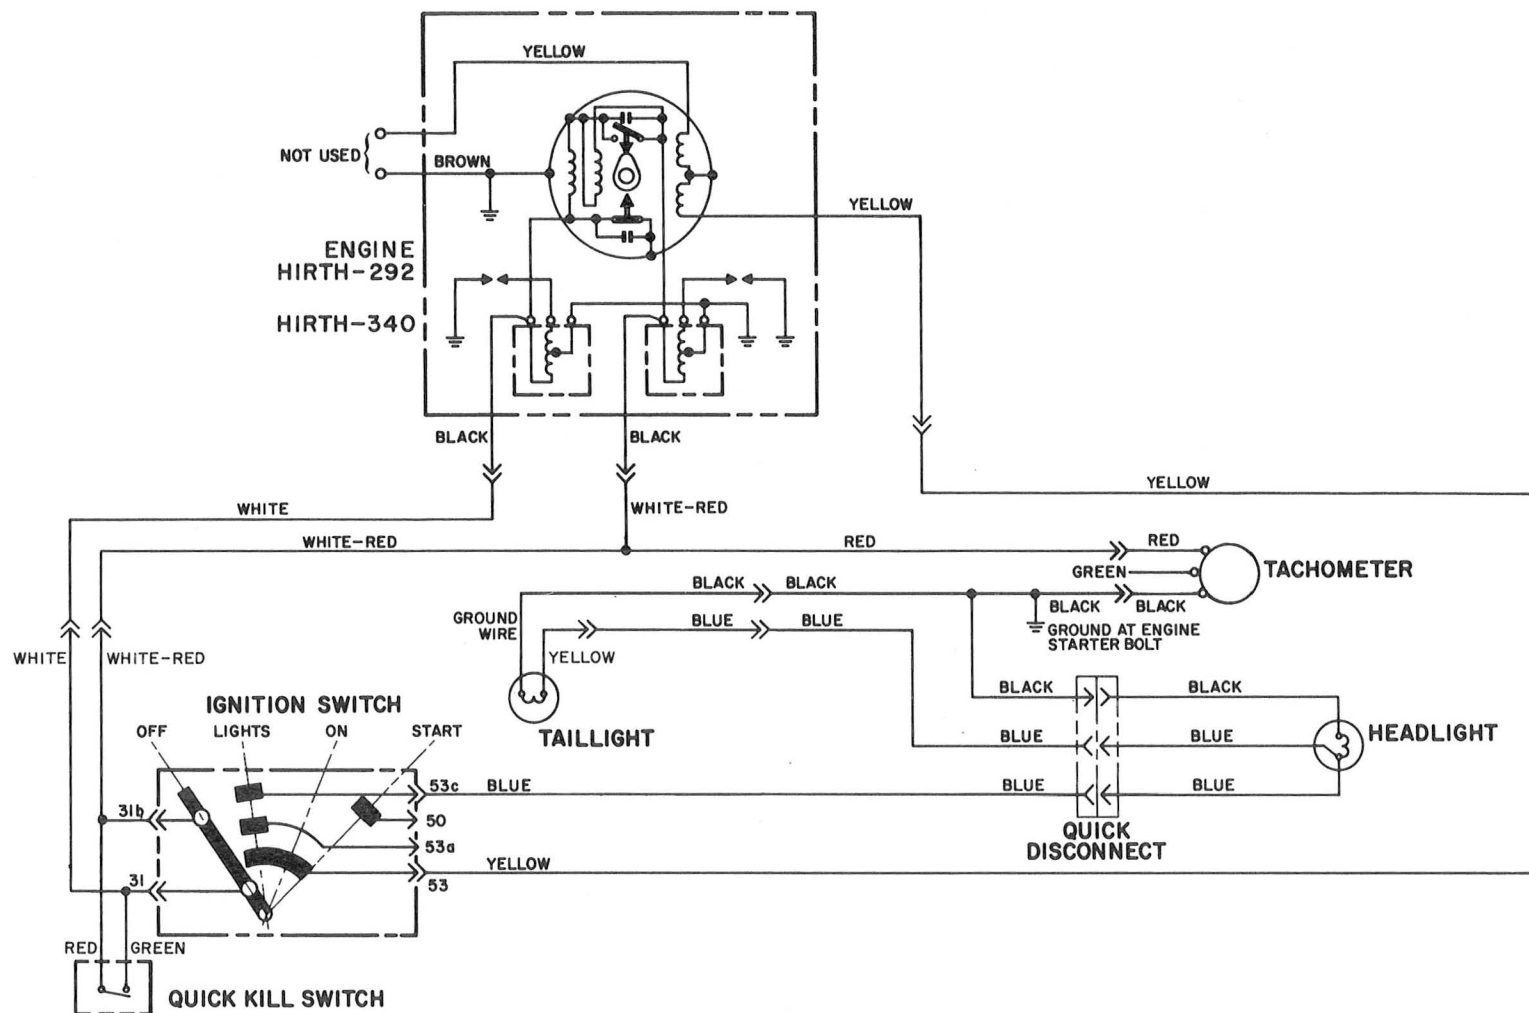

MODELS SD15M22B and SD15M23B

